

# **Product Datasheet - Technical Specifications**



More information in our Web-Shop at ▶ www.meilhaus.com

#### Your contact

Technical and commercial sales, price information, quotations, demo/test equipment, consulting:

Tel.: +49 - (0)81 41 - 52 71-0

E-Mail: sales@meilhaus.com

HIOKI

PHASE DETECTOR VOLTAGE DETECTOR Series



# PHASE · VOLTAGE DETECTORS

#### **DIGITAL PHASE DETECTOR PD3259-50**

Product warranty for 3 years Accuracy guaranteed for 1 year





With Z3210

Please see www.hioki.com for list of supported regions

GENNECT Cross Model PD3259-90 includes Z3210 as a set

PD3259-50

PD3259-90

Z3210

Bluetooth\*

Order code

Order code

Order code

Attach to enable Bluetooth® vireless technology













**CAT IV 600 V** 

Soil, residue, or moisture on the insulated wires may result in lower voltage and power values than their true values. Use a dry cloth to remove before measuring.

Meas	Detection functions	Phase detection, open phase, prediction of ground phase (Three-phase line)	
ureme	Three-phase AC voltage (line-to-line voltage and voltage to ground)	90.0 V to 520.0 V AC (Three-phase line) accuracy: ±2.0% rdg ±8 dgt	
Measurement arameters	Frequency	45 Hz to 66 Hz Accuracy: ±0.5% rdg ±1 dgt	
eters	Measurement targets	Covered cables, metal portions 1 Finished outer diameter 6 to 30 mm (0.24 to 1.18 in)	
	Operating temperature	-25°C to 65°C, 80% RH or less (non-condensating)	
	Storage temperature	-25°C to 65°C, 80% RH or less (non-condensating)	
	Dustproof and waterproof	IP54 (device body only)	
0	Standards	EN61010 (Safety), EN61326 Class A (EMC)	
Other	Power supply Continuous operating time	LR6 alkaline battery ×4 5 hours (Without Z3210)	
	Dimensions ( W × H × D )	84 × 146 × 46 mm (3.31 × 5.75 × 1.81 in) Cable length 50 cm (1.64 ft)	
	Weight	590 g (20.8 oz)	

<sup>11</sup> Shielded cables not supported



· CARRYING CASE C0203

Dimensions:

W135 mm (5.31 in) × H265 mm (10.43 in) × D65 mm (2.56 in)

- LR6 alkaline battery x4
- Color clips (White x2, red x2, blue x2, yellow x2)
- Spiral tubes (black ×1)
- · Instruction manual

#### **Options**

MAGNETIC STRAP Z5020



Z5020 C0203 Color clip

m (0.09 in) to φ17 mm (0.67 in) PD3129: Thin Conductors

PD3129-10: Thick Conductors

Order code

Order code

PD3129

PD3129-10



# PHASE DETECTOR PD3129, PD3129-10










PD3129

**CAT IV 600 V** 

PD3129-10

**CAT IV 600 V, CAT III 1000 V** 

Measurement parameters	Detection functions		Phase detection (positive and negative)		
	2	\/alta== =====	PD3129	70 to 600 V AC (continuous sine wave)	
	lea	Voltage range	PD3129-10	70 to 1000 V AC (continuous sine wave)	
	ns.	Frequency range		45 Hz to 66 Hz	
	reme	Measurement	PD3129	2.4 mm (0.09 in) to 17 mm (0.67 in) of insulated wiring	
		targets	PD3129-10	7 mm (0.28 in) to 40 mm (1.57 in) of insulated wiring	
	rame	Phase- detection indication	Positive	4 LEDs lit in clockwise order and the buzzer sounds intermittently, green arrow lights up	
	ters		Negative	4 LEDs lit in counterclockwise order and the buzze sounds continuously	
		Functions		Live line check, Battery check function	
Other		Operating temperature		0°C to 40°C, 80% RH or less (non-condensating)	
		Storage temperature		-20°C to 60°C, 80% RH or less (non-condensating)	
	Standards		EN61010 (Safety), EN61326 (EMC)		
	Power supply Continuous operating time		LR6 alkaline battery x 2 200 hours		
	Dimensions( W × H × D )		$70 \times 75 \times 30$ mm (2.76 × 2.95 × 1.18 in) Cable length 70 cm (2.30 ft)		
		Weight		PD3129: 200 g (7.1 oz), PD3129-10: 240 g (8.5 oz)	

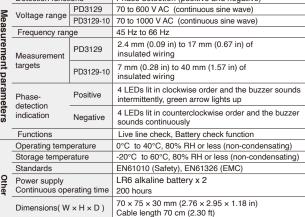

# Product warranty for 3 years Accuracy guaranteed for 1 year

**CAT IV 600 V** 

OFF.

## **VOLTAGE DETECTOR 3481-20**





Red for voltage detection

#### Accessories

Accessories · CARRYING CASE

· Spiral tube


· LR6 alkaline battery x 2

· Instruction manual

Strap

- LR44 button alkaline battery ×3
- · Instruction manual

3481-20 Order code

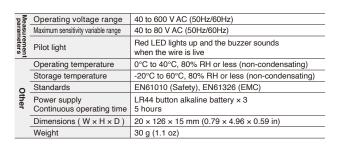

#### Function introduction DIGITAL PHASE DETECTOR PD3259-50

covered cables, and your 3-phase power line inspection is complete.





phase sequence

Missing phase prediction

If the instrument predicts that one wire of the 3-phase circuit is missing, the icon for the phase predicted to be missing will not be displayed

Ground phase prediction

If the "1" phase is grounded, the display will indicate "N" underneath " 1 " .

3-phase line voltage measurement Frequency measurement

#### Negative phase sequence display

- · Red backlight
- · with continuous tone



Measuring Frequency

## Using Bluetooth® communication with the Z3210



WIRELESS ADAPTER Z3210 (Option)



Attach to enable Bluetooth® wireless technology

#### Transport to the Excel® file



Open an Excel® file and select a cell. The measured value being held on the instrument's display will be transferred to the computer and entered into the selected cell.

Learn more Z3210





## **Transport to GENNECT Cross**



GENNECT Cross, a free app designed specifically for use with Hioki measuring instruments, lets you check and manage measurement results and create reports. The software provides a range of functionality that helps manage data in the field, including photographing measurement sites, placing measurement results on photographs, and saving hand

earn more GENNECT Cross



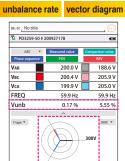

# Function introduction PHASE DETECTOR PD3129, PD3129-10

No-metal-contact design for the ultimate in safety,



Arrow: Green LED Buzzer: Intermittent sound

written memos.



Positive phase



Negative phase sequence display

- · Arrow: Not lit up
- · Buzzer: Continuous sound





Magnets for a more efficient workflow





200 hours of use with two AA batteries. Battery check function, Auto power off

# Function introduction VOLTAGE DETECTOR 3480, 3481

Non-contact voltage detector lets you verify the hot-line state of AC voltage through the wire or cable covering.



No need for lights (3481 Only)



Sensitivity adjustment function



Compact design that fits in a pocket





Handy clip with gap for strap.

CATS

#### Safety standard categories



#### **Drop proof**

Robust design capable of withstanding a drop from a height of 1 m onto concrete




Backlight

OFF	Auto power OFF Automatically turns off after a certain time
HOLD	Display hold
RMS	True RMS True RMS measurement for accurate measurement of even distorted current waveforms

## **Measurement Category · Anticipated Transient Overvoltage**

Under safety standards (EN61010 Series, JIS C 1010 Series), measurement is classified into Categories II to IV according to the measurement point's rated voltage to ground, current capacity (size of current that flows in a short-circuit fault), etc., and the transient overvoltage that occurs at the measurement point.

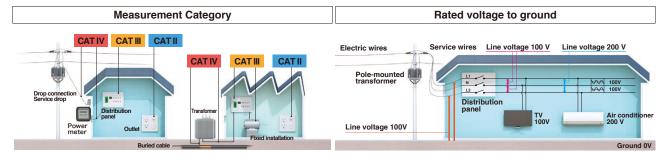

CAT II: Measurement at a point from the power plug to the equipment's power circuits, where equipment is directly connected to an outlet.

**CAT III:** Measurement at a point on the power distribution cabling or power supply circuits, or at a point from the distribution panel to a distribution terminal behind an outlet, where equipment (for example a fixed installation) takes electricity directly from a distribution panel.

CAT IV: Measurement at a point on a service drop to a building, or on the line from the drop connection to the power meter or distribution panel

#### **Anticipated Transient Overvoltage**

Rated voltage	Transient overvoltage				
to ground	CAT II	CAT III	CAT IV		
300 V	2500 V	4000 V	6000 V		
600 V	4000 V	6000 V	8000 V		
1000 V	6000 V	8000 V	12000 V		

Power lines in factories and similar facilities will at times include transient overvoltage (impulse voltage) that is around 10 times the power source voltage.

The transient overvoltage of the measurement points must be predicted in advance, and the instrument will need a safety design that will enable it to withstand such overvoltage.

Marks



600V


Measurement Category Rated voltage to ground


Assuming 600 V for the measurement point's voltage to ground, a Category IV location could potentially include transient overvoltage of 8000 V. Hence, CAT IV measurement instruments are designed to withstand transient overvoltage of 8000 V. CAT III measurement instruments can only withstand up to 6000 V, so if 8000 V transient overvoltage enters, it will cause insulation breakdown that could result in electric shock.

Never measure a measurement point with a higher category number than the category indicated on the measuring instrument. Doing so could lead to a serious accident such as electric shock.

### **Rectification Methods: True RMS and Mean**

A measuring instrument uses one of two rectification methods, "True RMS" or "Mean". Using mean rectification assumes that the signal is based on a sine wave without distortions in order to calculate the value. Distorted waveforms cannot be measured accurately using this method. As the performance of equipment increases, so do distorted waveforms. In order to accurately measure in these situations, using the True RMS method is necessary.





 $Note: Company\ names\ and\ product\ names\ appearing\ in\ this\ brochure\ are\ trademarks\ or\ registered\ trademarks\ of\ various\ companies.$ 

